

tempmate[®]-M2


OPERATION INSTRUCTIONS

 Start Button


 Stop Button

 RECORD Green LED


 STATUS Red LED

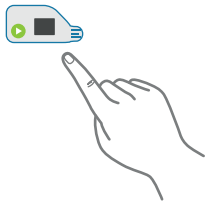

01 Keep green button pressed for minimum 5 seconds to start recording

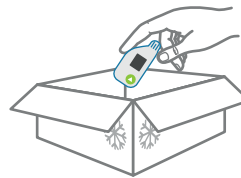

02 Add started tempmate[®]-M2 to your shipment

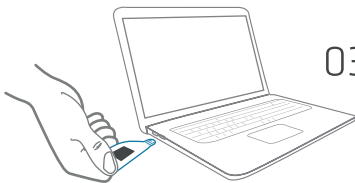

03 Connect stopped logger directly to USB port



04 The PDF report will be generated automatically

 LED Indication
 Display Indication


5 sec.

Start Logger

Rec. 


5 sec.

Stop Logger

Stop 


2 times

Set Mark
Mark limit full



Mark 
Mark 


1 time

Not started
Low battery


3 sec. 

Recording-OK
Recording-Alarm

Rec. 
Rec. 

Stopped-OK

Stop 


Stopped-Alarm

Stop 




For further information visit m2.tempmate.com